

# Download File PDF Repair Manual Bose Wave Radio

#Jenny



Finally I get this ebook, thanks for all these I can get now!

#Rio



Cool! I'am really happy

#Markus Jensen



I did not think that this would work, my best friend showed me this website, and it does! I get my most wanted eBook

#Hun Tsu



wtf this great ebook for free?!

#Che Salsa



My friends are so mad that they do not know how I have all the high quality ebook which they do not!

#Diego Butler



so many fake sites. this is the first one which worked! Many thanks



## BOSE WAVE® RADIO I, II, III TROUBLE SHOOTING GUIDE

Refer to the Bose Wave Radio service manuals, part numbers 174794, 191911 and 191514, for schematics, PCB layouts and part list. Line identification: BWR I, 3 AA battery backup, full AM external antenna. BWR II, 3 AA battery backup, no AM external antenna. BWR III, 9V battery backup.

Symptom	Check
Hammer Operation	1. Check for fractured solder joints on AC connector J11. BWR I and II: J11 (BWR III). 2. BWR I: Check for fractured solder joints at interconnects between display and main PCB. 3. Check for fractured cold solder joints on CD2 and CD1.
Unit inoperative	1. Check for open fuse F1. 2. Check for open J11. 3. Check for fractured solder joints on AC connector J11. 4. Check R801 for open. Replace with 1 Ohm, 120W fusible resistor, part number 195400-195. See Service Bulletin 191911-02. 5. BWR I and II: Check C4. Replace with part number 140248. See Service Bulletin 191514-05. 6. Fuzzing sound when unplugged. Check transistor Q401. 9V supply for display.
Remote control does not work or does not work in some locations	1. Check IR remote. 2. Reconnect spring interference magnet to the outside. Replace the IR sensor with IR sensor part number 197205. Connect a 1 uF capacitor, part number 149945-194, across R422. 3. Connect the positive side of the cap to the base of Q401 and the negative side to the ground side of R422. See Service Bulletin 174794-04. 4. Check speaker and antenna cables.
Volume goes to 99 when the customer uses the remote at high volume	BWR I: Place a 1 uF capacitor, 149945-194, in parallel with R422. See Service Bulletin 174794-02. BWR II: Place a 2.2 uF capacitor, part number 17812-225, in parallel with R13. See Service Bulletin 191514-05.
Floor FM reception when connected to cable	1. Check for fractured solder joint on F connector J109. 2. Remove CD to disconnect the power cord from the front end. The power cord is used as an antenna. When connected to cable, there are two paths for the signal that is fed to the front end. This can cause interference. See Service Bulletin 174794-05.
No or poor FM	1. BWR I and II: Check X101. BWR III: Check X300. 2. BWR I and II: Check C111. 3. Align front end, see service manual for procedures. 4. Use FM antenna. Check voltage at CD25, CD26, CD28. Should be 12V on pins 2, 4V on pins 1 and 3.
Floor AM Reception	1. Could be caused by dimmer switch connected to the same circuit. Remove CB for LIS response and CD for European response. See Service Bulletin 191911-01. 2. BWR I and II: In some units the PLL has low stability margin. Replace C131, change R136 to 22 Ohm, change R103 to 3k Ohm. See Service Bulletin 174794-01. 3. BWR I and II: Fractured solder joints on internal AM antenna. BWR I: Fuzzing in 5 Ohm, change R650 to 5 Ohm. F 650B is 1 Ohm. Change R650 to 2k Ohm. This change will only be noticeable at low listening levels. See Service Bulletin 191909-01.
100-megahertz or distortion at low listening levels	BWR I: Check for fracture of cold solder joints on CD25 and CD27. BWR II: R133 might be the wrong value. It should be 33k Ohm. See Service Bulletin 191909-01.
Remote control does not work when the display does not work	BWR I: On display PCB, change C205 to 1000 uF, 50V. Replace jumper Y313 with a 10 Ohm, 1Watt resistor. 1. BWR I: Ensure battery packs are fully charged. BWR I: PCB and battery are fully charged. 2. BWR I: Check X101. BWR III: Check X300. 3. BWR I: Check X101. BWR III: Check X300. 4. BWR I: Check X101. BWR III: Check X300.
No output after unit has been on for a period of time	1. BWR I: Check for 9V or 12V, check for solder flux on fusible resistor R422. 2. BWR I: Check for 9V or 12V, check for solder flux on fusible resistor R422.
CD function	BWR III: Check for 9V or 12V, check for solder flux on fusible resistor R422.

©2001 Bose Corporation Part Number 174794-101 02/2001

[Download PDF version of :](#)  
**Repair Manual Bose Wave Radio**